## SHIELDED 39 SERIES PLUG ASSEMBLY INSTRUCTIONS

Assembly steps 1 - 14:

Plugs installed on (GOOD) cable end, pair conductors in correct position for direct insertion into CAT 6 load bar.



Slide Strain Relief onto cable; push back out of way



Strip off approximately 1 ¼ inch of cable jacket



Remove cable jacket; Fold braided shield back




Slide ferrule onto cable jacket



**Crimp ferrule** 



Trim off excess braid strands flush with back of ferrule

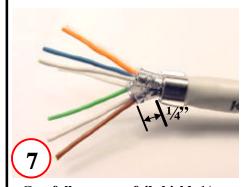

Carefully remove foil shields ¼ inch above ferrule



Align Org, Blu, & Brn pairs and cut ends at a 45 ° angle




Insert Org, Blu, & Brn pairs into load bar

Page 1 of 2 MN390005-A1

## SHIELDED 39 SERIES PLUG ASSEMBLY INSTRUCTIONS


**Assembly steps 1 – 14: (Cont.)** 

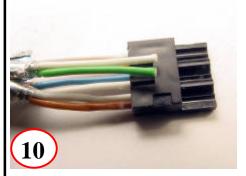

Dress Grn pair into load bar



Slide load bar down to foil shields, cut wires flush

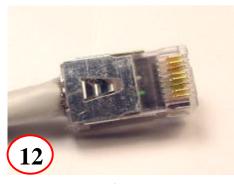

Insert load bar into plug body




Set plug blades using Stewart Connector Crimp Tool




Slide Strain Relief over plug and snap it into place

For Bad Cable End; Insert Step 7a Between Steps 7 & 8

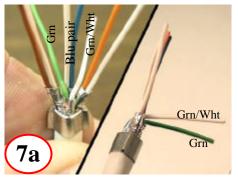

Bend Grn pair 90° around Blu pair

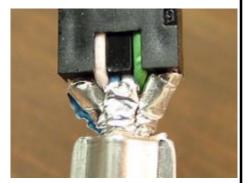

Close-up of Grn pair after being inserted into load bar

Page 2 of 2 MN390005-A1